


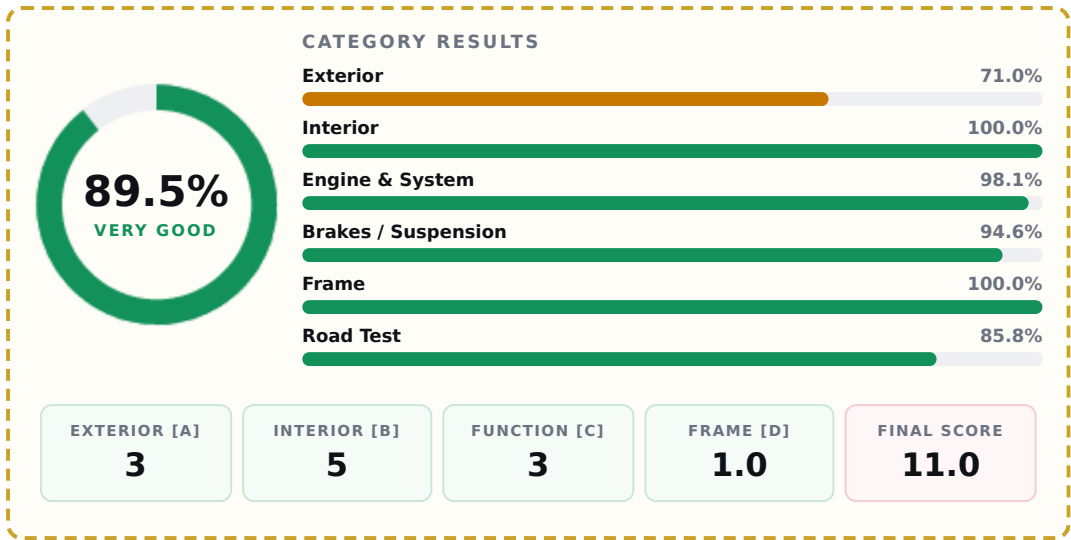

REPORT VERIFIED

Scan to verify this report online
inspection.toyotawalton.com/verify

VEHICLE & CUSTOMER SUMMARY

Registration No	AEY-860	Make & Model	Toyota Yaris Ativ 1.3 CVT	Year / Colour	2021 / White
Chassis / VIN	NSP150R7020725	Engine No	1NR2A33749	Mileage	31,804 KM
Customer	Nauman Tariq	Contact	0300-****78	Location	Toyota Walton Motors

MAJOR FINDINGS

Area	Finding	Result
Front Fender (Right)	Repainted with dry dents, filler detected	P2
Bonnet / Hood	Medium dent near right edge	B2
Rear Fender (Right)	Small dent above wheel arch	B1
Side Spoiler / Skirt (Left)	Scratch on lower edge	P1
Head Lamp (Right)	Lens crack — light broken, replace	X1
Legal case pending (if any)	Documents & Ownership	NO
Under manufacturer warranty	Expired	NO
Service history available	Irregular — gaps after 2024	NO
Joint ownership / finance / lease	Clear	NO
Original invoice available	Copy provided	NO

QUALITY LEVEL INDEX

Level	Score Range	Meaning
Level 5 — EXCELLENT	14.0 – 15.0	As good as a new car
Level 4 — GOOD	11.0 – 13.9	Good enough to be displayed (Current Result)
Level 3 — FAIR	8.0 – 10.9	Normal condition
Level 2 — POOR	6.0 – 7.9	Poor condition. Requires major repairs
Level 1 — BAD	2.1 – 5.9	Very inferior condition. Difficult to repair

Percentage scores are produced by the configured scoring rule set (TWM Default v1.2): each checkpoint carries a maximum deduction weight, the officer's answer produces an actual deduction, and category weights, sensitivity and rounding are managed from the Admin panel. The legacy TSURE score $[A + B + C] \times D$ is retained alongside it.



FULL VEHICLE DETAILS

Registration No	AEY-860	Registration City	Lahore	Year	2021
Manufacturer	Toyota	Model	Yaris	Variant	ATIV 1.3 CVT
Chassis / VIN	NSP150R7020725	Engine Number	1NR2A33749	Colour	White
Mileage	31,804 KM	Fuel Type	Petrol	Transmission	Automatic
No. of Owners	1	No. of Seats	5	A/C Configuration	Dual
Last Service	12 Jun 2026	Inspection Date	01 Sep 2026 11:00 AM	Dealership	Toyota Walton Motors

DOCUMENT INSPECTION


Check Item	Result	Remarks	Check Item	Result	Remarks
Ownership Documents			Compliance & Records		
Original Booklet / Smart Card	YES		Taxes / token cleared	YES	
Transferred in current owner name	YES		VIN plate present and readable	YES	
Invoice / Sales Certificate available	YES		Number plate matches booklet	YES	
If imported — import documents clear	NA	Locally assembled	Chassis punch matches excise record	YES	
Original invoice available	NO	Copy provided	Engine number matches excise record	YES	
Joint ownership / finance / lease	NO	Clear	Service history available	NO	Irregular — gaps after 2024
Clearance document available	NA		Under manufacturer warranty	NO	Expired
Legal case pending (if any)	NO		Warranty valid till	NA	
			Accessories & Keys		
			Owner's manual	YES	
			Spare key available	YES	

DIAGNOSTIC & MEASUREMENT READINGS

Measurement	Value	Unit	Status	Remarks
Front Left Tyre Tread	5.8	mm	GOOD	Even wear
Front Right Tyre Tread	4.2	mm	LOW TREAD	Replace within 5,000 km
Rear Left Tyre Tread	6.1	mm	GOOD	
Rear Right Tyre Tread	6.0	mm	GOOD	
Spare Tyre Tread	7.4	mm	GOOD	Unused
Battery Voltage (engine off)	12.4	V	NORMAL	12V maintenance-free
Charging Voltage (engine on)	14.1	V	NORMAL	Alternator output OK
OBD Scan — Stored Fault Codes	0	codes	CLEAR	Launch diagnostic scanner
Front Brake Pad Estimate	62	%	OK	
Rear Brake Shoe Estimate	71	%	OK	
Paint Depth — Front Bumper	238	um	REPAINTED	OEM range 90-140 um
Paint Depth — Front Right Fender	196	um	REPAINTED	Repair evidence



VEHICLE DAMAGE MAP

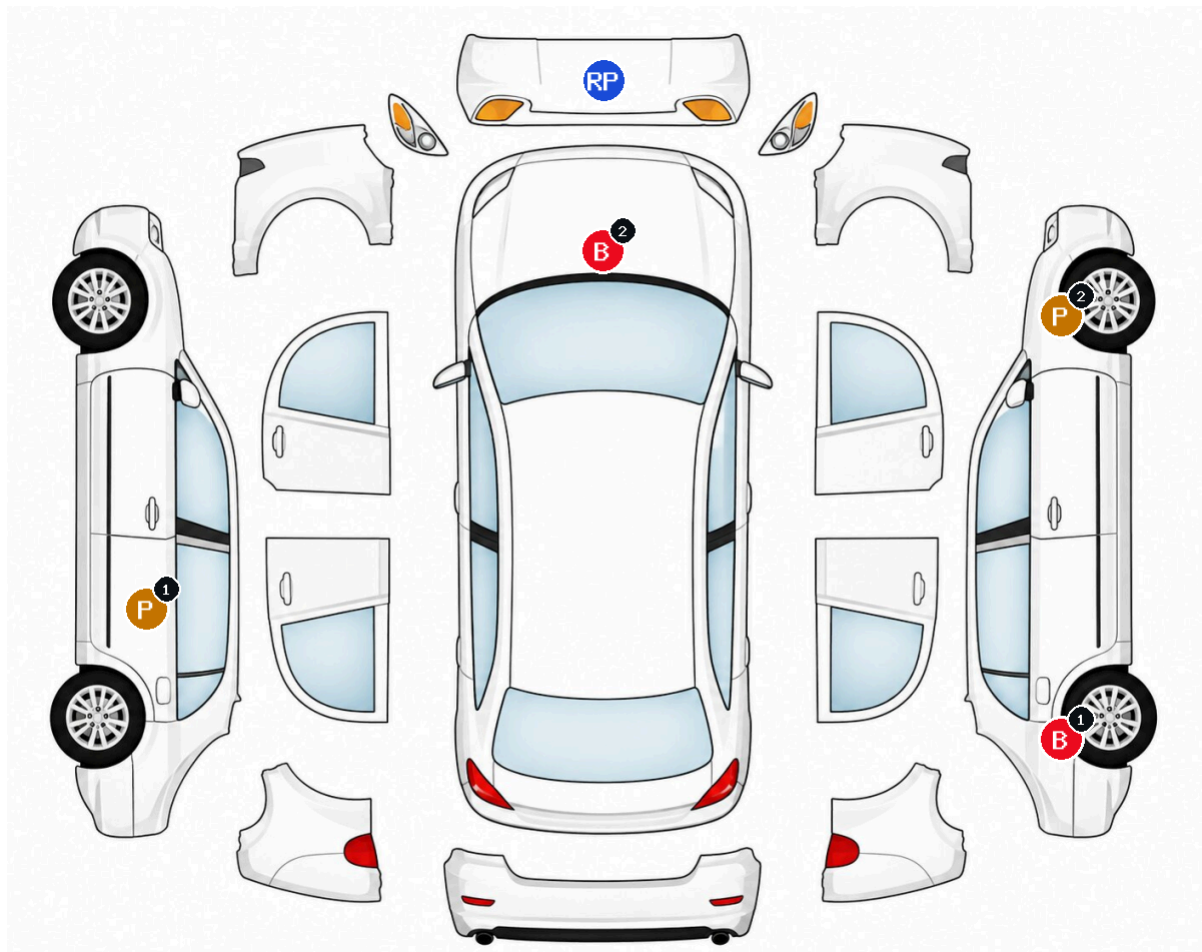

LEGEND

Code	Meaning	Code	Meaning	Code	Meaning
P1	Small paint / scratch	B1	Small dent or change in shape	X1	Small cut, crack, hole, missing part
P2	Medium paint / surface defect	B2	Medium dent or change in shape	X2	Medium cut, crack, hole, missing part
P3	Large paint / surface defect	B3	Large dent or change in shape	X3	Large cut, crack, hole, missing part
RP	Repainted panel (paint depth)	RL	Replaced panel	OK	No damage found

MARKED DAMAGE POINTS

#	Panel / Area	View	Code	Action	Officer Remarks
1	Front Fender (Right)	Right	P2	Repair	Repainted with dry dents, filler detected
2	Bonnet / Hood	Top	B2	Repair	Medium dent near right edge
3	Front Bumper	Front	RP	None	Full repaint detected via paint depth gauge
4	Rear Fender (Right)	Right	B1	Repair	Small dent above wheel arch
5	Side Spoiler / Skirt (Left)	Left	P1	Repair	Scratch on lower edge
6	Head Lamp (Right)	Front	X1	Replace	Lens crack — light broken

Damage levels: 1 = 0-2 in (size like a thumb) · 2 = 2-6 in (size like the flat of a hand) · 3 = 6-12 in (size like an elbow) · 4 = greater than 12 in (whole panel). Every panel on the diagram is bound to one checklist item, so a defect is recorded once and scored once.

EXTERIOR — 59 CHECKPOINTS ANSWERED · SCORE 71.0%

Check Item	Result	Remarks	Check Item	Result	Remarks
Front Section			Left Wheels		
Front Bumper	RP	Full repaint detected via paint depth gauge (238 um)	LHS Front Alloy	OK	
Front Spoiler	OK		LHS Front Tyre	OK	
Front Grille	OK		LHS Front Mud Flap	OK	
Head Lamp (Left)	OK		LHS Rear Alloy	OK	
Head Lamp (Right)	X1	Lens crack — light broken, replace	LHS Rear Tyre	OK	
Fog Lamp (Left)	OK		LHS Rear Mud Flap	OK	
Fog Lamp (Right)	OK		Right Side		
Bonnet / Hood	B2	Medium dent near right edge	Front Fender (Right)	P2	Repainted with dry dents, filler detected
Front Panel / Radiator Support Cover	OK		Side Mirror (Right)	OK	
Glass & Wipers			Front Door Panel (Right)	OK	
Windscreen (Front)	OK		Front Door Window (Right)	OK	
RH Front Wiper	OK		Rear Door Panel (Right)	OK	
LH Front Wiper	OK		Rear Door Window (Right)	OK	
Rear Windscreen	OK		Side Spoiler / Skirt (Right)	OK	
Rear Wiper	OK		Rear Fender (Right)	B1	Small dent above wheel arch
Antenna	OK		Tail Lamp (Right)	OK	
Roof Panel	OK		Rear Fender above Tail Lamp (Right)	OK	
Sunroof Glass	NA	Not equipped	Right Wheels		
Left Side			RHS Front Alloy	OK	
Front Fender (Left)	OK		RHS Front Tyre	REPAIR	Low tread 4.2 mm
Side Mirror (Left)	OK		RHS Front Mud Flap	OK	
Front Door Panel (Left)	OK		RHS Rear Alloy	OK	
Front Door Window (Left)	OK		RHS Rear Tyre	OK	
Rear Door Panel (Left)	OK		RHS Rear Mud Flap	OK	
Rear Door Window (Left)	OK		Rear Section		
Side Spoiler / Skirt (Left)	P1	Scratch on lower edge	Trunk / Boot Lid	OK	
Rear Fender (Left)	OK		Trunk Registration Plate Area	OK	
Tail Lamp (Left)	OK		Rear Bumper	OK	
Rear Fender above Tail Lamp (Left)	OK		Rear Spoiler	OK	
			Exhaust Tip / Muffler Visible Condition	OK	



EXTERIOR — 59 CHECKPOINTS ANSWERED · SCORE 71.0%

Check Item	Result	Remarks
Pillars & Structure (Visual)		
Front Pillar (Left)	OK	
Center Pillar (Left)	OK	
Rear Pillar (Left)	OK	
Rocker Panel (LH / RH)	OK	
Under Body Rust	OK	
Panel Gaps / Alignment	OK	

Check Item	Result	Remarks
------------	--------	---------

DEDUCTION POINTS

10.0

MAX POSSIBLE

138

HIGHEST LEVEL

2

ANSWERED

59

EXTERIOR %

71.0%

INTERIOR — 50 CHECKPOINTS ANSWERED · SCORE 100.0%

Check Item	Result	Remarks	Check Item	Result	Remarks
Dashboard			Rear Cabin		
Dashboard Body	OK		Rear Door Handles (L / R)	OK	
Glove Box	OK		Rear Door Trim (L / R)	OK	
A/C Vents (Center)	OK		Rear Power Window Buttons (L / R)	OK	
A/C Vent (Left)	OK		Rear Door Speakers	OK	
A/C Vent (Right)	OK		Rear Seat Lower	OK	
Steering Wheel	OK		Rear Seat Back	OK	
LCD / Radio / CD Player	OK		Rear Head Rests	OK	
Speedometer Cluster	OK		Rear Seat Belts	OK	
Infotainment System	OK		Rear Tray	OK	
Rear View Camera	OK		3rd Row Seat Lower	NA	5-seater
Front Camera	NA	Not equipped	Trunk		
360 Camera	NA	Not equipped	Luggage Space Center	OK	
Wireless Charging Pad	NA	Not equipped	Inner Trunk Trim (RH / LH)	OK	
Front Seats & Doors			Spare Tyre	OK	
Front Seat Lower (Left)	OK		Spare Wheel (Rim)	OK	
Front Seat Back (Left)	OK		Jack & Tools Kit	OK	
Front Head Rest (Left)	OK		Roof & Trim		
Front Seat Belt (Left)	OK		Sun Visors	OK	
Front Seat Lower (Right)	OK		Rear View Mirror (IRVM)	OK	
Front Seat Back (Right)	OK		Sun Roof Operation	NA	Not equipped
Front Head Rest (Right)	OK		Roof Garnish	OK	
Front Seat Belt (Right)	OK		Roof Lamp (Driver + Passenger)	OK	
Front Door Handles (L / R)	OK		Roof Lining	OK	
Front Door Trim (L / R)	OK		Roof Lining — Front / Rear Pillars	OK	
Front Power Window Buttons (L / R)	OK		Cleanliness		
Front Door Speakers	OK		Odor / Smell	OK	
Gear Console			Stains	OK	
Gear Knob	OK		Carpet / Floor	OK	
Gear Box Console	OK				
Console Box	OK				
Emergency Brake Handle	OK				
Cup Holders	OK				

DEDUCTION POINTS

0.0

MAX POSSIBLE

76

HIGHEST LEVEL

0

ANSWERED

50

INTERIOR %

100.0%

ENGINE & SYSTEM — 55 CHECKPOINTS ANSWERED · SCORE 98.1%

Check Item	Result	Remarks	Check Item	Result	Remarks
Engine			Transmission & Drivetrain		
Engine Oil Leakage	OK		Transmission Oil Leak	OK	
Coolant Leakage	OK		Shift Shock / Time Lag	OK	
Radiator Damage	OK		Gear Shifting	OK	
Abnormal Noise	OK		Gear Box Noise	OK	
Black Smoke	OK		Drive Shaft Defect / Boot Cut / Leakage	NA	
White Smoke	OK		Differential Noise	NA	
Blue Smoke	OK		Transmission Oil Condition	OK	
Idling Defect	OK		Transmission Foundations	OK	
RPM Defect	OK		Clutch Defect (manual vehicles)	NA	Automatic transmission
Defective Belts	OK		Electrical & Electronics		
Starter Motor Defect	OK		Defective Meters	OK	
Muffler / Exhaust Defect	OK		Warning Lamp (instrument panel)	OK	
Engine Sludge	OK		Horn Defect	OK	
Engine Replaced (details updated / not)	OK		Power Window Defect	OK	
Engine Mounts / Foundations	OK		Keyless / Cylinder Defect	OK	
Engine Oil Condition	S	Oil about to be changed — service due	Door Lock Defect	OK	
Air Filter Condition	OK		Audio System Defect / Missing	OK	
Battery Terminals / Mounting	OK		Antenna Defect	OK	
			Electronic Mirror Defect	OK	
			Wiper Operation Defect (Front / Rear)	OK	
			Head Lamp Defect	L	Right head lamp broken
			Fog Lamp Defect	OK	
			Battery Defect	OK	
			Defective A/C (duct check)	OK	
			ECU / Stored Fault Codes	OK	
			Steering Wheel Controls	OK	
			Reverse Sensor / Camera Defect	OK	
			Wiring Harness Condition	OK	

ENGINE & SYSTEM — 55 CHECKPOINTS ANSWERED · SCORE 98.1%

Check Item	Result	Remarks	Check Item	Result	Remarks
Optional Equipment			Other Features		
Navigation System	NA		Defective Seat Belts	OK	
Cruise Control	NA		Seat Movement Defect	OK	
Traction Control	NA		Jack & Tools Kit	OK	
Auto Headlight / Auto Wiper	OK		Steering Wheel Levers — Wiper / Washer	OK	
Rear Cross Traffic Alert	NA		Steering Wheel Levers — Lights	OK	
Blind Spot Monitor	NA		Trunk Release Lever / Button	OK	
Tyre Pressure Monitoring System	NA		Fuel Cap Release Lever / Button	OK	
Hill Start Assist	NA		Bonnet Release Lever / Button	OK	
Push Button Start	NA		Hoses / Pipes	OK	
Parking Sensors	NA		Modified Exhaust	OK	
Climate Control A/C	NA		Modified Suspension	OK	
DRLs	NA		Hybrid / EV System		
USB / AUX Ports	OK		HV Coolant Level / Leakage	NA	Petrol vehicle
Electric Seat Defect	NA		Inverter Wire Harness (burns / damage)	NA	Petrol vehicle
Ventilated Seat Defect	NA		HV Battery Maintenance Filter	NA	Petrol vehicle
Electronic Trunk Door Defect	NA		HV Battery Charging / Discharging During Drive	NA	Petrol vehicle
Sun Roof Defect	NA		Appearance of HV Components in MID	NA	Petrol vehicle
Paddle Shift Defect	NA		Drive Mode EV / Eco / Sport / Normal	NA	Petrol vehicle
Automatic Sliding Door	NA		Wind Flow From HV Battery Vent	NA	Petrol vehicle

DEDUCTION POINTS

2.0

MAX POSSIBLE

103

HIGHEST LEVEL

0

ANSWERED

55

ENGINE & SYSTEM %

98.1%



BRAKES / SUSPENSION — 18 CHECKPOINTS ANSWERED · SCORE 94.6%

Check Item	Result	Remarks
Brakes		
Brake Disc Damage	OK	
Braking Effectiveness	OK	
ABS / EBD Defect	OK	
Pedal Handling Defect	OK	
Brake Noise / Caliper Noise	OK	
Wheel Bearing Defect	OK	
Hand Brake Holding	OK	

Check Item	Result	Remarks
Suspension		
Bent Suspension / Lower Arm	OK	
Shock Absorber Defect	OK	
Leakage / Crack / Cut	OK	
Suspension Noise	OK	
Bushes / Links Condition	OK	
Wheel Alignment	S	Slight pull to the left
Steering		
Steering Oil Leak	OK	
Steering Rack Boots Cut	OK	
Jammed Steering	OK	
Steering Noise	OK	
Defective Telescopic Tilt	OK	

DEDUCTION POINTS

1.0

MAX POSSIBLE

28

HIGHEST LEVEL

0

ANSWERED

18

BRAKES / SUSPENSION %

94.6%



FRAME — 28 CHECKPOINTS ANSWERED · SCORE 100.0%

Check Item	Result	Remarks	Check Item	Result	Remarks
Front Structure			Rear Structure		
Front Cross Member	OK		Rear Wheel House	OK	
Upper Core Support	OK		Rear Floor Panel	OK	
Core Support (Left)	OK		Rear Inside Panel	OK	
Core Support (Right)	OK		Rear Side Member (Left)	OK	
Front Inside Panel	OK		Rear Side Member (Right)	OK	
Front Side Member (Left)	OK		Rear Cross Member	OK	
Front Side Member (Right)	OK		End Panel (WE)	OK	
Dash Panel	OK		Roof Panel (WE)	OK	
Pillars & Cabin Structure			Rear Fender (WE) — Left	OK	
Front Pillar (Left)	OK		Rust on Frame	OK	
Front Pillar (Right)	OK				
Center Pillar (Left)	OK				
Center Pillar (Right)	OK				
Rocker Panel (WE) — Left	OK				
Rocker Panel (WE) — Right	OK				
Center Floor Panel	OK				
Floor Cross Member	OK				
Floor Side Member (Left)	OK				
Floor Side Member (Right)	OK				

DEDUCTION POINTS

0.0

MAX POSSIBLE

84

HIGHEST LEVEL

0

ANSWERED

28

FRAME %

100.0%

ROAD TEST — 13 CHECKPOINTS ANSWERED · SCORE 85.8%

Check Item	Result	Remarks	Check Item	Result	Remarks
Performance			Noise & Comfort		
Acceleration	EXCELLENT		Suspension Noise	EXCELLENT	
Engine Performance	EXCELLENT		Wheel Bearing Noise	EXCELLENT	
Gear Shifting	GOOD	Smooth CVT operation	Abnormal Noise	EXCELLENT	
Overall Driveability	EXCELLENT		A/C Performance While Moving	GOOD	
Handling & Braking			Instrument Warning Lights	EXCELLENT	
Steering Response	GOOD				
Braking	GOOD	Minor vibration reported by customer			
Alignment / Pulling	ATTENTION	Slight pull to left			
Vibration	GOOD				

DEDUCTION POINTS
3.7

MAX POSSIBLE
26

HIGHEST LEVEL
0

ANSWERED
13

ROAD TEST %
85.8%



PHOTOGRAPHIC EVIDENCE

No photographs were attached to this inspection.



INSPECTION OFFICER REMARKS

Front right fender repair with dry dents. Front bumper repainted (paint depth 238 um against OEM range of 90-140 um). Front right head light is broken and requires replacement. Front right tyre tread has reached 4.2 mm and should be replaced within approximately 5,000 km. Engine oil is due for change. Wheel alignment shows a slight pull to the left during road test. Frame and structural areas were fully inspected and found clean with no accident evidence.

RECOMMENDATION

Overall recommendation	Legacy Level	Percentage Result
GOOD TO BUY	Level 4 — GOOD (11.0)	89.5% — VERY GOOD · rule set TWM Default v1.2

REPORT VERIFICATION



Scan to verify

Inspection Number	TWM-INS-2026-000001	Report Version	v1 (current)
Verification URL	127.0.0.1:8088/verify/TWM-INS-2026-000001	Status	FINALIZED
Finalized At	01 Sep 2026, 04:40 PM (Asia/Karachi)	Inspection Officer	Mudassir Ashraf

Mudassir Ashraf

Certified Inspection Officer · Toyota Walton Motors

Thank you for choosing Toyota Walton Motors

Drive with Confidence · 0300-8600378

DISCLAIMER

You agree, at your own risk, to have your vehicle inspected. The Inspection Report covers only the items specifically listed within it, and no dismantling or removal of any vehicle parts is performed during the process. The Report is based solely on a visual assessment of accessible areas and components and is intended for informational purposes only. It does not constitute a warranty, guarantee, or recommendation for or against the purchase of the inspected vehicle. The condition described in the Inspection Report reflects the vehicle's state only at the specific time and date of inspection, and Toyota Walton Motors makes no representations or guarantees regarding any changes that may occur to the vehicle thereafter. Toyota Walton Motors accepts no responsibility for any damage that may occur or become apparent during or after the inspection. In any event, the total liability of the Company shall not exceed the fee paid for the Inspection Report. The inspection must be conducted in the presence of the person requesting it or their authorised representative. By receiving this digital inspection report you confirm your unconditional acceptance of all the terms stated above.